



(OLD SWITCHES: 34255, 38816, & 36867)

Wiring OLD to NEW

FEED SENSOR SW-2	COM	Black 1 - Red
Part # ST50701-C	NC	Black 4 - Orange
	NO	Black 3 - Purple

Set Delay:

To set the seconds of the delay press and hold the **Black** button. The first flash will zero the seconds delay time. Each additional flash will increase the delay by 10 seconds. To set the minutes of the delay press and hold the **Red** button. The first flash will zero the minutes delay time. Each additional flash will increase the delay by 1 minute.

Timer Mode Set:

To set the timer mode, press and release the **Black** button 6 times. The light should start to flash. Press the **Red** button to change between modes. The **Green** light represents a dead end system, and the **Red** light represents a Multiflo system. After you are finished press the **Black** button again to return to normal operation.

Calibration:

Make sure that nothing is touching the sensor. Press the **Red** and the **Black** button together. Wait until both lights are off and then release the buttons.

L.E.D. Indicator

- Green = Feed
- Green Flash = Waiting for feed.
- Red = No Feed
- Red Flash = Delay time is active

½ hp or 5 amp max